

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2016-5042; Directorate Identifier 2015-NM-140-AD]

RIN 2120-AA64

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all The Boeing Company Model 737-600, -700, -700C, -800, -900 and -900ER series airplanes. This proposed AD was prompted by an evaluation by the design approval holder (DAH) indicating that certain fastener locations in the window corner surround structure are subject to widespread fatigue damage (WFD). This proposed AD would require repetitive high frequency eddy current (HFEC) inspections for cracking in certain fastener locations in the window corner surround structure, and repair if necessary. We are proposing this AD to detect and correct fatigue cracking around certain fastener locations that could cause multiple window corner skin cracks, which could result in rapid decompression and consequent reduced structural integrity of the airplane.

**DATES:** We must receive comments on this proposed AD by May 20, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone: 206-544-5000, extension 1; fax: 206-766-5680; Internet: <https://www.myboeingfleet.com>. You may view this referenced service information at

the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-5042.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-5042; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Jason Deutschman, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6595; fax: 425-917-6590; email: [jason.deutschman@faa.gov](mailto:jason.deutschman@faa.gov).

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-5042; Directorate Identifier 2015-NM-140-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

Structural fatigue damage is progressive. It begins as minute cracks, and those cracks grow under the action of repeated stresses. This can happen because of normal operational conditions and design attributes, or because of isolated situations or

incidents such as material defects, poor fabrication quality, or corrosion pits, dings, or scratches. Fatigue damage can occur locally, in small areas or structural design details, or globally. Global fatigue damage is general degradation of large areas of structure with similar structural details and stress levels. Multiple-site damage is global damage that occurs in a large structural element such as a single rivet line of a lap splice joining two large skin panels. Global damage can also occur in multiple elements such as adjacent frames or stringers. Multiple-site-damage and multiple-element-damage cracks are typically too small initially to be reliably detected with normal inspection methods. Without intervention, these cracks will grow, and eventually compromise the structural integrity of the airplane, in a condition known as WFD. As an airplane ages, WFD will likely occur, and will certainly occur if the airplane is operated long enough without any intervention.

The FAA's WFD final rule (75 FR 69746, November 15, 2010) became effective on January 14, 2011. The WFD rule requires certain actions to prevent structural failure due to WFD throughout the operational life of certain existing transport category airplanes and all of these airplanes that will be certificated in the future. For existing and future airplanes subject to the WFD rule, the rule requires that DAHs establish a limit of validity (LOV) of the engineering data that support the structural maintenance program. Operators affected by the WFD rule may not fly an airplane beyond its LOV, unless an extended LOV is approved.

The WFD rule (75 FR 69746, November 15, 2010) does not require identifying and developing maintenance actions if the DAHs can show that such actions are not necessary to prevent WFD before the airplane reaches the LOV. Many LOVs, however, do depend on accomplishment of future maintenance actions. As stated in the WFD rule, any maintenance actions necessary to reach the LOV will be mandated by airworthiness directives through separate rulemaking actions.

In the context of WFD, this action is necessary to enable DAHs to propose LOVs that allow operators the longest operational lives for their airplanes, and still ensure that WFD will not occur. This approach allows for an implementation strategy that provides flexibility to DAHs in determining the timing of service information development (with FAA approval), while providing operators with certainty

regarding the LOV applicable to their airplanes.

The FAA has received a report indicating that an evaluation by the DAH has indicated that certain fastener locations in the window corner surround structure are subject to WFD. Fatigue cracking around certain fastener locations could cause multiple window corner skin cracks, which could result in rapid decompression and consequent reduced structural integrity of the airplane.

#### Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 737-53A1351, dated July 8, 2015. The service information describes procedures for HFEC inspections for cracking in certain fastener locations in the window corner surround structure and repair. This service information is reasonably available because the interested parties have access to it

through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in the service information identified previously, except as discussed under "Difference Between this Proposed AD and the Service Information." For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-5042.

#### Difference Between This Proposed AD and the Service Information

Boeing Alert Service Bulletin 737-53A1351, dated July 8, 2015, specifies to contact the manufacturer for instructions on how to repair certain conditions, but this proposed AD would require repairing those conditions in one of the following ways:

- In accordance with a method that we approve; or
- Using data that meet the certification basis of the airplane, and that have been approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) whom we have authorized to make those findings.

#### Costs of Compliance

We estimate that this proposed AD affects 1,528 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

#### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection .....	38 work-hours × \$85 per hour = \$3,230 [per inspection cycle].	\$0 [per inspection cycle] .....	\$3,230 [per inspection cycle]	\$4,935,440 [per inspection cycle].

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This

proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA-2016-5042; Directorate Identifier 2015-NM-140-AD.

#### (a) Comments Due Date

We must receive comments by May 20, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all The Boeing Company Model 737-600, -700, -700C, -800, -900 and -900ER series airplanes, certificated in any category.

#### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Unsafe Condition

This AD was prompted by an evaluation by the design approval holder (DAH) indicating that certain fastener locations in the window corner surround structure are subject to

widespread fatigue damage (WFD). We are issuing this AD to detect and correct fatigue cracking around certain fastener locations that could cause multiple window corner skin cracks, which could result in rapid decompression and consequent reduced structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Repetitive Inspections and Repair**

At the applicable time specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 737-53A1351, dated July 8, 2015: Do an external high frequency eddy current (HFEC) inspection for cracking of the skin around the fastener locations at the upper forward and lower aft corners of each window between station (STA) 360 and STA 540, as applicable, and at the lower forward and upper aft corners of each window between STA 727 and STA 887, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1351, dated July 8, 2015. Repeat the inspection thereafter at the applicable times specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 737-53A1351, dated July 8, 2015. If any crack is found during any inspection, repair before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(h) Exception to the Service Bulletin Specifications**

Although Boeing Alert Service Bulletin 737-53A1351, dated July 8, 2015, specifies to contact Boeing for repair instructions, and specifies that action as "RC" (Required for Compliance), this AD requires repair before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. To be approved, the repair method, modification

deviation, or alteration deviation must meet the certification basis of the airplane and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(j) Related Information**

(1) For more information about this AD, contact Jason Deutschman, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle ACO, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6595; fax: 425-917-6590; email: [jason.deutschman@faa.gov](mailto:jason.deutschman@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone: 206-544-5000, extension 1; fax: 206-766-5680; Internet: <https://www.myboeingfleet.com>. You may view the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on March 24, 2016.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-07577 Filed 4-4-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2016-5041; Directorate Identifier 2015-NM-102-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 747-8 and 747-8F series airplanes. This proposed

AD was prompted by a report that static strength analysis has shown that the aluminum transmission aft bearing plate assemblies have inadequate structural strength for one or more of the required load cases, including cases for drive system jam, flap skew, and structural damage tolerance. Inadequate structural strength can result in damage to the transmission aft bearing plate assemblies. This proposed AD would require removing aluminum transmission aft bearing plate assemblies from the flap track and installing titanium transmission aft bearing plate assemblies to the flap track. We are proposing this AD to prevent inadequate structural strength of transmission aft bearing plate assemblies. This condition could result in damaged transmission aft bearing plate assemblies, which could result in incorrect operation and departure of the flap from the airplane and consequent loss of controllability of the airplane.

**DATES:** We must receive comments on this proposed AD by May 20, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-5041.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-