

identified in an RC step, must be done to comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(6) The inspections specified in paragraph (g) of this AD are approved as an AMOC to paragraph (h) of AD 2006–11–11 for the inspections of Significant Structural Items (SSI) 53–30–07 and 53–60–07 (fuselage lap splices, left and right upper fastener row) listed in the May 2003 or June 2005 revision of the Boeing 757 Maintenance Planning Data (MPD) Document D622N001–9. This AMOC applies only to the common areas identified in paragraphs (m)(6)(i) and (m)(6)(ii) of this AD. All provisions of AD 2006–11–11 that are not specifically referenced in the above statements remain fully applicable and must be complied with as specified in AD 2006–11–11. Operators may revise their FAA-approved maintenance or inspection program with these alternative inspections for common areas.

(i) Common areas inspected before the effective date of this AD in accordance with the Accomplishment Instructions of Boeing Special Attention Service Bulletin 757–53–0090, dated June 2, 2005.

(ii) Common areas inspected in accordance with the Accomplishment Instructions of Boeing Special Attention Service Bulletin 757–53–0090, Revision 1, dated November 19, 2015.

#### (n) Related Information

(1) For more information about this AD, contact Eric Schrieber, Aerospace Engineer, Airframe Branch, ANM–120L, FAA, Los Angeles Aircraft Certification Office (ACO), 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5348; fax: 562–627–5210; email: [eric.schrieber@faa.gov](mailto:eric.schrieber@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, 3855 Lakewood Boulevard, MC D800–0019, Long Beach, CA 90846–0001; telephone: 206–544–5000, extension 2; fax: 206–766–5683; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on May 5, 2016.

**Michael Kaszycki,**

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016–11168 Filed 5–11–16; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2015–0077; Directorate Identifier 2013–NM–254–AD]

RIN 2120–AA64

#### Airworthiness Directives; ATR—GIE Avions de Transport Régional Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Supplemental notice of proposed rulemaking (NPRM); reopening of comment period.

**SUMMARY:** We are revising an earlier proposed airworthiness directive (AD) for certain ATR—GIE Avions de Transport Régional Model ATR42–500 and Model ATR72–212A airplanes. The NPRM proposed to require measuring the gap between the Type III Emergency Exit doors and certain overhead stowage compartment fittings; removing certain fittings from the overhead stowage compartments and measuring the gap between the Type III Emergency Exit doors and the overhead stowage compartment hooks, if necessary; and re-installing or repairing, as applicable, the Type III Emergency Exit doors. The NPRM was prompted by a report indicating that interference occurred between a Type III Emergency Exit door and the surrounding passenger cabin furnishing during a production check. This action revises the NPRM by adding new proposed requirements for modifying the overhead stowage compartments. We are proposing this supplemental NPRM (SNPRM) to prevent interference between a Type III Emergency Exit door and the overhead stowage compartment fitting installed on the rail; which could result in obstructed opening of a Type III Emergency Exit door during an emergency evacuation. Since these actions impose an additional burden over those proposed in the NPRM, we are reopening the comment period to allow the public the chance to comment on these proposed changes.

**DATES:** We must receive comments on this SNPRM by June 27, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–

30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

• *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this SNPRM, contact ATR—GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–0077; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1137; fax: 425–227–1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2015–0077; Directorate Identifier 2013–NM–254–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>.

[www.regulations.gov](http://www.regulations.gov), including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain ATR—GIE Avions de Transport Régional Model ATR42–500 and Model ATR72–212A airplanes. The NPRM published in the **Federal Register** on January 23, 2015 (80 FR 3531) (“the NPRM”). The NPRM was prompted by a report indicating that interference occurred between a Type III Emergency Exit door and the surrounding passenger cabin furnishing during a production check. The NPRM proposed to require measuring the gap between the Type III Emergency Exit doors and certain overhead stowage compartment fittings; removing certain fittings from the overhead stowage compartments and measuring the gap between the Type III Emergency Exit doors and the overhead stowage compartment hooks, if necessary; and re-installing or repairing, as applicable, the Type III Emergency Exit doors.

### Actions Since the NPRM Was Issued

Since we issued the NPRM, we have determined that, in order to address the identified unsafe condition, additional requirements are needed for modifying the overhead stowage compartments (including removing the hooks and fittings from the lateral rails) and re-identifying the overhead stowage compartments with new part numbers. The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2015–0018, dated February 5, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition on certain ATR—GIE Avions de Transport Régional Model ATR42–500 and Model ATR72–212A airplanes. The MCAI states:

Interference between a Type III Emergency Exit door opening and surrounding passenger cabin furnishing was detected during a production check.

Subsequent investigation identified an insufficient gap between the emergency exit door internal skin structure and the overhead stowage compartment fitting, installed on the rail, as a cause of the interference.

This condition, if not detected and corrected, could prevent an unobstructed opening of both Type III Emergency Exit doors in case of emergency evacuation.

Prompted by this finding, EASA issued AD 2013–0280 [<http://ad.easa.europa.eu/ad/>

2013–0280] to require a one-time check of the gap between the Type III Emergency Exit door internal skin and a relevant fitting and, depending on findings, the accomplishment of applicable corrective action(s). That [EASA] AD was considered to be a temporary measure.

Since that [EASA] AD was issued, ATR developed a design solution to ensure that no interference with surrounding structure occurs during opening of an emergency exit. ATR Service Bulletins (SB) ATR42–25–0185, SB ATR42–25–0186, SB ATR72–25–1148 and SB ATR72–25–1149 were issued to provide the necessary modification instructions for in-service aeroplanes.

For the reason described above, this [EASA] AD retains the requirements of EASA AD 2013–0280, which is superseded, and requires modification of the overhead bin attachment adjacent to the Type III emergency exit doors [The modification includes removing the hooks and fittings from the lateral rails and re-identifying the overhead stowage compartments].

Required actions include an additional measurement of the gap between the internal skin and overhead stowage compartment hooks of both Type III Emergency Exits, if necessary. Corrective actions include re-installing the Type III Emergency Exit doors and doing a repair. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–0077.

### Related Service Information Under 1 CFR Part 51

Avions de Transport Régional Service has issued the following service information:

- ATR Service Bulletin ATR42 25–0180, dated August 19, 2013, which describes procedures for, among other things, removing certain fittings from the overhead stowage compartments, measuring the gap between the Type III Emergency Exit doors and the overhead stowage compartment hooks, re-installing the Type III Emergency Exit doors, and repair.

- ATR Service Bulletin ATR72 25–1141, dated August 19, 2013, which describes procedures for, among other things, removing certain fittings from the overhead stowage compartments, measuring the gap between the Type III Emergency Exit doors and the overhead stowage compartment hooks, and re-installing the Type III Emergency Exit doors.

- ATR Service Bulletin ATR42–25–0185, dated November 21, 2014, which describes procedures for modifying the overhead stowage compartments.

- ATR Service Bulletin ATR42–25–0186, dated November 21, 2014, which describes procedures for modifying the overhead stowage compartments.

- ATR Service Bulletin ATR72–25–1148, dated November 21, 2014, which describes procedures for modifying the overhead stowage compartments.

- ATR Service Bulletin ATR72–25–1149, dated November 21, 2014, which describes procedures for modifying the overhead stowage compartments.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

### Comments

We gave the public the opportunity to participate in developing this proposed AD. We received no comments on the NPRM or on the determination of the cost to the public.

### FAA’s Determination and Requirements of This SNPRM

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

Certain changes described above expand the scope of the NPRM. As a result, we have determined that it is necessary to reopen the comment period to provide additional opportunity for the public to comment on this SNPRM.

### Costs of Compliance

We estimate that this SNPRM affects 4 airplanes of U.S. registry.

We also estimate that it would take about 4 work-hours per product to comply with the new basic requirements of this SNPRM. The average labor rate is \$85 per work-hour. Required parts would cost about \$0 per product. Based on these figures, we estimate the cost of this SNPRM on U.S. operators to be \$1,360, or \$340, or per product.

In addition, we estimate that any necessary follow-on actions would take about 1 work-hour for a cost of \$85 per product. We have no way of determining the number of aircraft that might need these actions.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of

the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2015–0077; Directorate Identifier 2013–NM–254–AD.

#### (a) Comments Due Date

We must receive comments by June 27, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the airplanes, certificated in any category, identified in paragraphs (c)(1) and (c)(2) of this AD.

(1) ATR—GIE Avions de Transport Régional Model ATR42–500 airplanes, all manufacturer serial numbers (MSNs) on which ATR Modification 6518 has been embodied in production, except those airplanes on which ATR Modification 7294 has been embodied in production.

(2) ATR—GIE Avions de Transport Régional Model ATR72–212A airplanes on which ATR Modification 6517 has been embodied in production, except those airplanes on which ATR Modification 7294 has been embodied in production.

#### (d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

#### (e) Reason

This AD was prompted by a report indicating that interference occurred between a Type III Emergency Exit door and the surrounding passenger cabin furnishing during a production check. We are issuing this AD to prevent interference between a Type III Emergency Exit door and the overhead stowage compartment fitting installed on the rail; which could result in obstructed opening of a Type III Emergency Exit door during an emergency evacuation.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Measurement of Gap Between Type III Emergency Exit Doors and Certain Overhead Stowage Compartment Fittings

For all airplanes, except those airplanes on which ATR Modification 7152 has been embodied in production and except airplanes having MSN 1002, 1005, 1089, 1094, 1095, 1097, 1098, 1099, 1100, 1101, or 1102: Within 2 months after the effective date of this AD, measure the gap between each Type III Emergency Exit door, left hand (LH) and right hand (RH), and the overhead stowage compartment fitting installed on the rail, by unlocking and slightly rotating the LH and RH Type III Emergency Exit doors with the doors remaining on the lower fittings. Use a shim gauge 6 millimeters (mm) (0.236 inch) thick, to measure the gap between the internal skin of the doors and the relevant fittings, part number (P/N) S2522924620000 (LH fitting) and P/N S2522924620100 (RH fitting).

**Note 1 to paragraph (g) of this AD:** Illustrations may be found in the applicable ATR Illustrated Parts Catalog (IPC) 25–23–02, figure 87, item 90/100.

**Note 2 to paragraph (g) of this AD:** It might be necessary to pull on the door blanket to correctly see the door internal skin.

#### (h) Re-Installation of Type III Emergency Exit Doors

During the measurement required by paragraph (g) of this AD, if it is determined that there is a gap equal to or greater than 6 mm (0.236 inch): Before further flight, re-install the LH and RH Type III Emergency Exit Doors, in accordance with paragraph 3.C.(1)(d) of the Accomplishment Instructions of ATR Service Bulletin ATR42–25–0180, dated August 19, 2013; or ATR Service Bulletin ATR72–25–1141, dated August 19, 2013; as applicable.

#### (i) Removal of Fitting and Measurement of Gap Between Door Internal Skin and Overhead Stowage Compartment Hooks

During the measurement required by paragraph (g) of this AD, if it is determined that there is a gap less than 6 mm (0.236 inch): Before further flight, remove the fitting P/N S2522924620000 (LH fitting) or P/N S2522924620100 (RH fitting), and measure the gap between the internal skin of the LH and RH Type III Emergency Exit Doors and the overhead stowage compartment hooks, in accordance with the Accomplishment Instructions of ATR Service Bulletin ATR42–25–0180, dated August 19, 2013; or ATR72–25–1141, dated August 19, 2013; as applicable.

(1) If, during the measurement required by paragraph (i) of this AD, it is determined that there is a gap equal to or greater than 6 mm (0.236 inch): Before further flight, re-install the LH and RH Type III Emergency Exit Doors, in accordance with the Accomplishment Instructions of ATR Service Bulletin ATR42–25–0180, dated August 19, 2013; or ATR72–25–1141, dated August 19, 2013; as applicable.

(2) If, during the measurement required by paragraph (i) of this AD, it is determined that there is a gap less than 6 mm (0.236 inch): Before further flight, repair using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or ATR—GIE Avions de Transport Régional’s EASA Design Organization Approval (DOA).

#### (j) Modification of Overhead Stowage Compartments and Re-Identification of Part Number

Within 4 months after the effective date of this AD: Modify the overhead stowage compartments, in accordance with the Accomplishment Instructions of the applicable service information identified in paragraphs (j)(1) through (j)(4) of this AD.

(1) For airplanes identified in ATR Service Bulletin ATR42–25–0185, dated November 21, 2014: ATR Service Bulletin ATR42–25–0185, dated November 21, 2014.

(2) For airplanes identified in ATR Service Bulletin ATR42–25–0186, dated November 21, 2014: ATR Service Bulletin ATR42–25–0186, dated November 21, 2014.

(3) For airplanes identified in ATR Service Bulletin ATR72–25–1148, dated November 21, 2014: ATR Service Bulletin ATR72–25–1148, dated November 21, 2014.

(4) For airplanes identified in ATR Service Bulletin ATR72–25–1149, dated November 21, 2014: ATR Service Bulletin ATR72–25–1149, dated November 21, 2014.

**(k) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax: 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or ATR—GIE Avions de Transport Régional's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

**(l) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2015-0018, dated February 5, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0077.

(2) For service information identified in this AD, contact ATR—GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr); Internet <http://www.aerochain.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on May 4, 2016.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-11096 Filed 5-11-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF DEFENSE****GENERAL SERVICES  
ADMINISTRATION****NATIONAL AERONAUTICS AND  
SPACE ADMINISTRATION****48 CFR Parts 14 and 52**

**[FAR Case 2016-003; Docket No. 2016-0003, Sequence No. 1]**

**RIN 9000-AN21**

**Federal Acquisition Regulation:  
Administrative Cost To Issue and  
Administer a Contract**

**AGENCY:** Department of Defense (DoD), General Services Administration (GSA), and the National Aeronautics and Space Administration (NASA).

**ACTION:** Proposed rule.

**SUMMARY:** DoD, GSA, and NASA are proposing to amend the Federal Acquisition Regulation (FAR) to revise the estimated administrative cost to award and administer a contract, for the purpose of evaluating bids for multiple awards.

**DATES:** Interested parties should submit written comments to the Regulatory Secretariat Division at one of the addresses shown below on or before July 11, 2016 to be considered in the formation of the final rule.

**ADDRESSES:** Submit comments in response to FAR case 2016-003 by any of the following methods:

- *Regulations.gov*: <http://www.regulations.gov>. Submit comments via the Federal eRulemaking portal by searching for "FAR Case 2016-003". Select the link "Comment Now" that corresponds with "FAR Case 2016-003." Follow the instructions provided on the screen. Please include your name, company name (if any), and "FAR Case 2016-003" on your attached document.

- *Mail*: General Services Administration, Regulatory Secretariat Division (MVCB), ATTN: Ms. Flowers, 1800 F Street NW., 2nd Floor, Washington, DC 20405.

*Instructions:* Please submit comments only and cite FAR Case 2016-003, in all correspondence related to this case. All comments received will be posted without change to <http://www.regulations.gov>, including any personal and/or business confidential information provided.

**FOR FURTHER INFORMATION CONTACT:** Mr. Michael O. Jackson, Procurement Analyst, at 202-208-4949 for clarification of content. For information pertaining to status or publication

schedules, contact the Regulatory Secretariat Division at 202-501-4755. Please cite FAR Case 2016-003.

**SUPPLEMENTARY INFORMATION:****I. Background**

DoD, GSA, and NASA are proposing to revise the provision of the FAR that addresses the Government's cost to award and administer a contract, for the purpose of evaluating bids for multiple awards. The FAR provision at 52.214-22, Evaluation of Bids for Multiple Awards, which was issued in March 1990, reflects that \$500 is the administrative cost to the Government for issuing and administering contracts. Based on inflation factors and escalating annual Consumer Price Index (CPI) data available, an upward adjustment of \$500 in the provision to \$1,000 is a realistic reflection of the actual cost to the Government. We used the CPI calculator at the following web address, <http://data.bls.gov/cgi-bin/cpicalc.pl>, to calculate the upward adjustment. We plugged in the base line year 1990 and \$500 and it came up with \$907.00, and we rounded up to \$1,000. This cost will be reviewed periodically and updated as deemed appropriate.

**II. Discussion and Analysis**

Amendments to FAR subparts 14.2 and 52.2 are proposed by this rulemaking. A monetary adjustment is proposed for FAR 14.201-8, Price Related Factors, and clause 52.214-22, Evaluation of Bids for Multiple Awards. The adjustment from \$500 to \$1,000 is to reflect a realistic estimate of the cost to the Government to issue and administer a contract.

**III. Executive Orders 12866 and 13563**

Executive Orders (E.O.s) 12866 and 13563 direct agencies to assess all costs and benefits of available regulatory alternatives and, if regulation is necessary, to select regulatory approaches that maximize net benefits (including potential economic, environmental, public health and safety effects, distributive impacts, and equity). E.O. 13563 emphasizes the importance of quantifying both costs and benefits, of reducing costs, of harmonizing rules, and of promoting flexibility. This is not a significant regulatory action and, therefore, was not subject to review under Section 6(b) of E.O. 12866, Regulatory Planning and Review, dated September 30, 1993. This proposed rule is not a major rule under 5 U.S.C. 804.

**V. Regulatory Flexibility Act**

DoD, GSA, and NASA do not expect this proposed rule to have a significant