

Ring, Bolt, Mixing Lever Gear Unit (flight controls).

Issued in Fort Worth, Texas, on May 23, 2016.

Scott A. Horn,

*Acting Manager, Rotorcraft Directorate,
Aircraft Certification Service.*

[FR Doc. 2016-13103 Filed 6-3-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2014-0338; Directorate Identifier 2014-CE-010-AD; Amendment 39-18495; AD 2016-08-18]

RIN 2120-AA64

Airworthiness Directives; Piper Aircraft, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; correction.

SUMMARY: The FAA is correcting an airworthiness directive (AD) that published in the **Federal Register**. That AD applies to certain Piper Aircraft, Inc. Model PA-31-350 airplanes. The wing locations of engine TIO-540-J2B and LTIO-540-J2B in table 1 of the Applicability, paragraph (c), section are incorrect. This document corrects that error. In all other respects, the original document remains the same; however we are publishing the entire rule in the **Federal Register**.

DATES: This final rule is effective June 6, 2016.

ADDRESSES: You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0338; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Gary Wechsler, Aerospace Engineer, FAA, Atlanta Aircraft Certification Office, 1701 Columbia Avenue, College Park, Georgia 30337; telephone: (404) 474-5575; fax: (404) 474-5606; email: gary.wechsler@faa.gov.

SUPPLEMENTARY INFORMATION: Airworthiness Directive 2016-08-18, Amendment 39-18495 (81 FR 26106, May 2, 2016), currently requires inspecting the fuel hose assembly and the turbocharger support assembly for proper clearance between them, inspecting each assembly for any sign of damage, and making any necessary repairs or replacements for certain Piper Aircraft, Inc. Model PA-31-350 airplanes.

As published, the wing locations of engine TIO-540-JJ2B and LTIO-540-J2B in table 1 of the Applicability, paragraph (c), section are incorrect. This document corrects that error.

Although no other part of the preamble or regulatory information has been corrected, we are publishing the entire rule in the **Federal Register**.

The effective date of this AD remains June 6, 2016.

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2016-08-18 Piper Aircraft, Inc.:

Amendment 39-18495; Docket No. FAA-2014-0338; Directorate Identifier 2014-CE-010-AD.

(a) Effective Date

This AD is effective June 6, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Piper Aircraft, Inc. Model PA-31-350 airplanes, serial numbers 31-5001 through 31-5004, 31-7305005 through 31-8452024, and 31-8253001 through 31-8553002, certificated in any category, that are equipped with the following engines and fuel pump hose assemblies:

TABLE 1 TO PARAGRAPH (c) OF THIS AD—APPLICABLE ENGINES AND FUEL PUMP HOSE ASSEMBLIES

Engine	Manufacturer's hose name	Manufacturer's part No. (P/N)	Hose description
LTIO-540-J2B (right wing)	Hose Assembly—Fuel	Piper 39995-034	Inlet fuel hose to engine fuel pump.
TIO-540-J2B (left wing)	Hose, Fuel pump to Injector	Lycoming LW-12877-6S142	Exit fuel hose from engine fuel pump.
LTIO-540-J2BD (right wing)	Hose, Fuel pump to Injector	Lycoming LW-12877-6S142	Exit fuel hose from engine fuel pump.
TIO-540-J2BD (left wing)	Hose Assembly—Fuel	Piper 39995-034	Inlet fuel hose to engine fuel pump.

(d) Subject

Joint Aircraft System Component (JASC)/ Air Transport Association (ATA) of America Code 73: Engine Fuel and Control.

(e) Unsafe Condition

This AD was prompted by a report of an engine fire caused by a leak in the fuel pump inlet hose. We are issuing this AD to correct the unsafe condition on these products.

(f) Compliance

Comply with this AD within the compliance times specified in paragraphs

(g)(1) through (j)(2) of this AD, unless already done.

(g) Ensure Proper Clearance Between the Fuel Hose Assembly and the Turbocharger Support Assembly

(1) Within the next 60 hours time-in-service (TIS) after June 6, 2016 (the effective date of this AD) or within the next 6 months after June 6, 2016 (the effective date of this AD), whichever occurs first, inspect to determine the clearance between the inlet and exit fuel hose assemblies listed in table 1 to paragraph (c) of this AD, and each

turbocharger support assembly, Lycoming P/N LW-18302. There should be a minimum 3/16-inch clearance. Do the inspection following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(2) Before further flight after the inspection required in paragraph (g)(1) of this AD, if the measured clearance is less than 3/16-inch, make all necessary adjustments to make the clearance a minimum of 3/16-inch between the inlet and exit fuel hose assemblies listed in table 1 to paragraph (c) of this AD and each turbocharger support assembly,

Lycoming P/N LW-18302, following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(h) Visually Inspect the Fuel Hose Assembly and Replace If Necessary

(1) Within the next 60 hours TIS after June 6, 2016 (the effective date of this AD) or within the next 6 months after June 6, 2016 (the effective date of this AD), whichever occurs first, visually inspect the inlet and exit fuel hose assemblies listed in table 1 to paragraph (c) of this AD for evidence of leaking, cracking, chafing, and any other sign of damage. Do the inspection following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(2) Before further flight after the inspection required in paragraph (h)(1) of this AD, if any evidence of leaking, cracking, chafing, or any other sign of damage is found in any inlet or exit fuel hose assembly listed in table 1 to paragraph (c) of this AD, replace the fuel hose assembly with a serviceable part. Do the replacement following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(i) Visually Inspect the Turbocharger Support Assembly and Replace If Necessary

(1) Within the next 60 hours TIS after June 6, 2016 (the effective date of this AD) or within the next 6 months after June 6, 2016 (the effective date of this AD), whichever occurs first, visually inspect each turbocharger support assembly, Lycoming P/N LW-18302, for evidence of chafing and any other signs of damage. Do the inspection following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(2) Before further flight after the inspection required in paragraph (i)(1) of this AD, if any evidence of chafing or any other sign of damage is found on any turbocharger support assembly, replace Lycoming P/N LW-18302 with a serviceable part. Do the replacement following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(j) Engine Run-Up

(1) If any fuel line component was adjusted or replaced during any actions required in paragraphs (g)(1) through (i)(2) of this AD, before further flight, perform an engine run-up on the ground to check for leaks. Do the engine run-up following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(2) If any leaks found during the engine run-up required in paragraph (j)(1) of this AD emanate from any fuel line component adjusted, repaired, or replaced during any actions required in paragraphs (g)(1) through (i)(2) of this AD, before further flight, take all necessary corrective actions following the INSTRUCTIONS section of Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(k) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Atlanta Aircraft Certification Office (ACO), FAA, has the

authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in the Related Information section of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(l) Related Information

For more information about this AD, contact Gary Wechsler, Aerospace Engineer, FAA, Atlanta ACO, 1701 Columbia Avenue, College Park, Georgia 30337; telephone: (404) 474-5575; fax: (404) 474-5606; email: gary.wechsler@faa.gov.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Piper Aircraft, Inc. Service Bulletin No. 1257A, dated August 4, 2015.

(ii) Reserved.

(3) For Piper Aircraft, Inc. service information identified in this AD, contact Piper Aircraft, Inc., 926 Piper Drive, Vero Beach, Florida 32960; telephone: (772) 567-4361; fax: (772) 978-6573; Internet: www.piper.com/home/pages/Publications.cfm.

(4) You may view this service information at FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on May 31, 2016.

Pat Mullen,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-13226 Filed 6-3-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2016-0449; Airspace Docket No. 16-ASW-2]

Amendment of Class E Airspace; Clovis, NM

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This action modifies Class E airspace extending upward from 700 feet above the surface at Portales Municipal Airport, Clovis, NM. Decommissioning of the Portales non-directional radio beacon (NDB), cancellation of NDB approaches at Portales Municipal Airport, and implementation of area navigation (RNAV) procedures have made this action necessary for the safety and management of Instrument Flight Rules (IFR) operations at the airport. This action also updates the geographic coordinates for Portales Municipal Airport to coincide with the FAA's aeronautical database.

DATES: Effective 0901 UTC, September 15, 2016. The Director of the Federal Register approves this incorporation by reference action under Title 1, Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

ADDRESSES: FAA Order 7400.9Z, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at http://www.faa.gov/air_traffic/publications/. For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.9Z at NARA, call 202-741-6030, or go to http://www.archives.gov/federal-register/code_of_federal-regulations/ibr_locations.html.

FAA Order 7400.9, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

FOR FURTHER INFORMATION CONTACT:

Jeffrey Claypool, Federal Aviation Administration, Operations Support Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX 76177; telephone (817) 222-5711.