

annual meeting or in a written report sent to all members.

\* \* \* \* \*

■ 9. Revise § 705.10 to read as follows:

#### § 705.10 Appeals.

(a) *Appeals of non-qualification.* A Qualifying Credit Union whose application for a loan or technical assistance grant has been denied, under § 705.7(f), for failure of a qualification may appeal that decision to the NCUA Board in accordance with the following:

(1) Within thirty days of its receipt of a notice of non-qualification, a credit union may appeal the decision to the NCUA Board. The scope of the NCUA Board's review is limited to the threshold question of qualification and not the issue of whether, among qualified applicants, a particular loan or technical assistance grant is funded.

(2) The foregoing procedure shall apply only with respect to Applications received by NCUA during an open period in which funds are available and NCUA has called for Applications. Any Application submitted by an applicant during a period in which NCUA has not called for Applications will be rejected, except for those Applications submitted under § 705.8. Any such rejection shall not be subject to appeal or review by the NCUA Board.

(b) *Appeals of technical assistance grant reimbursement denials.* Pursuant to NCUA Interpretative Ruling and Policy Statement 11-1, any Participating Credit Union may appeal a denial of a technical assistance grant reimbursement to NCUA's Supervisory Review Committee. All appeals of technical assistance grant reimbursements must be submitted to the Supervisory Review Committee within 30 days from the date of the denial. The decisions of the Supervisory Review Committee are final and may not be appealed to the NCUA Board.

[FR Doc. 2016-14718 Filed 6-20-16; 8:45 am]

BILLING CODE 7535-01-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2016-7264; Directorate Identifier 2015-NM-185-AD]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A330-200, -200 Freighter, and -300 series airplanes; and Model A340-500 and -600 series airplanes. This proposed AD was prompted by a quality control review on the final assembly line, which determined that the wrong aluminum alloy was used to manufacture several structural parts. This proposed AD would require a one-time eddy current conductivity measurement of certain cabin and cargo compartment structural parts to determine if an incorrect aluminum alloy was used, and replacement of any affected part with a serviceable part. We are proposing this AD to detect and replace structural parts made of incorrect aluminum alloy. This condition could result in reduced structural integrity of the airplane.

**DATES:** We must receive comments on this proposed AD by August 5, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7264; or in person at the Docket Management Facility between 9 a.m.

and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1138; fax 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-7264; Directorate Identifier 2015-NM-185-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

##### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2015-0206, dated October 12, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Airbus Model A330-200, -200 Freighter, and -300 series airplanes; and Model A340-500 and -600 series airplanes. The MCAI states:

Following an Airbus quality control review on the final assembly line, it was discovered that wrong aluminum alloy was used to manufacture several structural parts.

This condition, if not detected and corrected, could reduce the structural integrity of the aeroplane.

To address this potential unsafe condition, Airbus issued Service Bulletin (SB) A330-53-3261, SB A330-53-3262, and SB A340-53-5072, as applicable to aeroplane type, to provide instructions to identify the affected parts.

For the reasons described above, this [EASA] AD requires a one-time Special Detailed Inspection (SDI) [eddy current conductivity measurements] of certain cabin and/or cargo compartment parts for material identification and, depending on findings, replacement with serviceable parts.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7264.

#### Related Service Information Under 14 CFR Part 51

We reviewed the following service information:

- Airbus Service Bulletin A330–53–3261, including Appendixes 01, 02, and 03, dated June 23, 2015.
- Airbus Service Bulletin A330–53–3262, including Appendixes 01 and 02, dated June 23, 2015.
- Airbus Service Bulletin A340–53–5072, including Appendixes 01 and 02, dated June 23, 2015.

The service information describes procedures for a one-time eddy current conductivity measurement of certain cabin and cargo compartment structural parts to determine if an incorrect aluminum alloy was used, and replacement of any affected part with a serviceable part. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

#### Costs of Compliance

We estimate that this proposed AD affects 37 airplanes of U.S. registry.

We also estimate that it would take about 11 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$34,595, or \$935 per product.

In addition, we estimate that any on-condition repairs would take about 45

work-hours and would require parts costing \$0, for a cost of \$3,825 per product. We have no way of determining the number of aircraft that might need these repairs.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all available costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2016–7264; Directorate Identifier 2015–NM–185–AD.

#### (a) Comments Due Date

We must receive comments by August 5, 2016.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the Airbus airplanes identified in paragraphs (c)(1) and (c)(2) of this AD, certificated in any category.

(1) Airbus Model A330–201, –202, –203, –223, –223F, –243, –243F, –301, –302, –303, –321, –322, –323, –341, –342, and –343 airplanes, having manufacturer serial numbers identified in Airbus Service Bulletin A330–53–3261, dated June 23, 2015; and/or Airbus Service Bulletin A330–53–3262, dated June 23, 2015.

(2) Airbus Model A340–541 and –642 airplanes, manufacturer serial numbers 1030, 1040, 1079, 1091, 1102, and 1122.

#### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Reason

This AD was prompted by a quality control review on the final assembly line, which determined that the wrong aluminum alloy was used to manufacture several structural parts. We are issuing this AD to detect and replace structural parts made of incorrect aluminum alloy. This condition could result in reduced structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) One-time Measurement

Within 6 years after the effective date of this AD, but not exceeding 12 years since the date of issuance of the original certificate of airworthiness or the date of issuance of the original export certificate of airworthiness: Do a one-time eddy current conductivity measurement of the cabin and cargo compartment structural parts identified in the "Affected Part Number" column of table 1 to paragraphs (g) and (h) of this AD to determine if an incorrect aluminum alloy

was used, in accordance with the Accomplishment Instructions of the applicable service information identified in paragraphs (g)(1), (g)(2), and (g)(3) of this AD.

(1) For cargo compartment structural parts for Model A330 airplanes: Airbus Service Bulletin A330–53–3261, including Appendixes 01, 02, and 03, dated June 23, 2015.

(2) For cabin structural parts for Model A330 airplanes: Airbus Service Bulletin A330–53–3262, including Appendixes 01 and 02, dated June 23, 2015.

(3) For cargo compartment structural parts for Model A340 airplanes: Airbus Service Bulletin A340–53–5072, including Appendixes 01 and 02, dated June 23, 2015.

**TABLE 1 TO PARAGRAPHS (g) AND (h) OF THIS AD—PARTS TO BE INSPECTED/INSTALLED**

Affected part No.	Acceptable replacement part No.	Area
F5347126620600	F5347126620000	Cabin
F5347126621000	F5347126620400	Cabin
F5347170420400	F5347170420400	Cargo
F5347170420600	F5347170420600	Cargo
F5377004320300	F5377004320051	Cargo
F5397096620200	F5397096620200	Cargo
G5367131300000	G5367131300000	Cargo
G5367173700000	G5367173700000	Cargo
G5367173800000	G5367173800000	Cargo

#### (h) Replacement

If during the inspection required by paragraph (g) of this AD, any affected part having a part number specified in table 1 to paragraphs (g) and (h) of this AD is found to have a measured value greater than that specified in Figure A–GFAAA, Sheet 02, “Inspection Flowchart,” of the applicable service information identified in paragraphs (g)(1), (g)(2), and (g)(3) of this AD: Before further flight, replace with an acceptable replacement part having a part number specified in table 1 to paragraphs (g) and (h) of this AD, in accordance with the Accomplishment Instructions of the applicable service information identified in paragraphs (g)(1), (g)(2), and (g)(3) of this AD.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1138; fax 425–227–1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using

any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2015–0206, dated October 12, 2015, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7264.

(2) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on June 9, 2016.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016–14430 Filed 6–20–16; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2016–7415; Directorate Identifier 2015–SW–076–AD]

RIN 2120–AA64

#### Airworthiness Directives; Airbus Helicopters Deutschland GmbH

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for Airbus Helicopters Deutschland GmbH (Airbus Helicopters) Model MBB–BK 117 C–2 and MBB–BK 117 D–2 helicopters. This proposed AD would require repetitive visual inspections and a one-time torque of each hydraulic module plate assembly attachment point (attachment point). This proposed AD is prompted by a design reassessment showing the current attachment point design is insufficient in preventing an attachment point failure. The proposed actions are intended to prevent failure of an attachment point, loss of the hydraulic module plate, and subsequent loss of control of the helicopter.

**DATES:** We must receive comments on this proposed AD by August 22, 2016.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Docket:* Go to <http://www.regulations.gov>. Follow the online instructions for sending your comments electronically.

- *Fax:* 202–493–2251.

- *Mail:* Send comments to the U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590–0001.

- *Hand Delivery:* Deliver to the “Mail” address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7415; or in person at the Docket Operations Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the European Aviation Safety Agency (EASA) AD, the economic evaluation, any comments received, and other