

**(j) Exception to the Service Information**

Where Aviation Partners Boeing Service Bulletin AP737-27-002, Revision 2, dated March 1, 2016, specifies to contact Boeing for appropriate action, and specifies that action as Required for Compliance (RC): Before further flight, repair using a method approved in accordance with the procedures specified in paragraph (k) of this AD.

**(k) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (l)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (j) of this AD: For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (k)(4)(i) and (k)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(l) Related Information**

(1) For more information about this AD, contact Fnu Winarto, Aerospace Engineer, Systems and Equipment Branch, ANM-130S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6659; fax: 425-917-6590; email: [fnu.winarto@faa.gov](mailto:fnu.winarto@faa.gov).

(2) For service information identified in this AD, contact Aviation Partners Boeing, 2811 South 102nd Street, Suite 200, Seattle, WA 98168; phone: 206-830-7699; fax: 206-

767-3355; email: [leng@aviationpartners.com](mailto:leng@aviationpartners.com); Internet: <http://www.aviationpartnersboeing.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 14, 2016.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-14966 Filed 6-27-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2016-7267; Directorate Identifier 2016-NM-015-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Bombardier, Inc. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model DHC-8-102, -103, and -106 airplanes, Model DHC-8-200 series airplanes, and Model DHC-8-300 series airplanes. This proposed AD was prompted by several occurrences of loss of airspeed data on both pilot and co-pilot air speed indicators due to the accumulation of ice on the pitot probes. An investigation revealed that the accumulation of ice was due to inoperative pitot probe heaters. This proposed AD would require replacing the existing circuit breakers in both the left and right side of the pitot heater system with circuit breakers that have higher trip points. We are proposing this AD to prevent circuit breakers from tripping and cutting power supply to the pitot probe heater, which could cause loss of airspeed data and result in the flightcrew not being able to control the airspeed of the airplane.

**DATES:** We must receive comments on this proposed AD by August 12, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone: 416-375-4000; fax: 416-375-4539; email: [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet: <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7267; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Assata Dessaline, Aerospace Engineer, Avionics and Services Branch, ANE-172, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7301; fax: 516-794-5531.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-7267; Directorate Identifier 2016-NM-015-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>.

www.regulations.gov, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian AD CF-2016-04, dated February 1, 2016 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Bombardier, Inc. Model DHC-8-102, -103, and -106 airplanes, Model DHC-8-200 series airplanes, and Model DHC-8-300 series airplanes. The MCAI states:

There have been several occurrences of loss of airspeed data on both pilot and co-pilot Airspeed Indicators (ASI) due to the accumulation of ice on the pitot probes. Subsequent investigation revealed that the build up of ice on the pitot probes was due to inoperative pitot probe heaters. When flying in heavy precipitations, the increased heat required by the pitot probe to clear ice

build up may result in a current demand in excess of the trip point of the associated circuit breakers (CB). Under this condition, the CB may trip and cut power supply to the heater. If not corrected, the loss of airspeed data may result in the crew not being able to control the aeroplane’s airspeed.

This [Canadian] AD is issued to mandate the replacement of the existing CBs with CBs that have higher trip points.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7267.

**Related Service Information Under 14 CFR Part 51**

We reviewed Bombardier Service Bulletin 8-30-39, dated November 11, 2015, and Bombardier Service Bulletin 8-30-40, dated November 11, 2015. The service information describes replacing the existing circuit breakers in both the left and right side of the pitot heater system with circuit breakers that have higher trip points. This service information is reasonably available

because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

**Costs of Compliance**

We estimate that this proposed AD affects 83 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement .....	20 work-hours × \$85 per hour = \$1,700 .....	Up to \$1,194 ....	\$2,894	\$240,202

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national

Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA-2016-7267; Directorate Identifier 2016-NM-015-AD.

**(a) Comments Due Date**

We must receive comments by August 12, 2016.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Bombardier, Inc. Model DHC-8-102, -103, -106, -201, -202, -301, -311, and -315 airplanes, certificated in any category, serial numbers 003 through 672 inclusive.

**(d) Subject**

Air Transport Association (ATA) of America Code 30, Ice and rain protection.

**(e) Reason**

This AD was prompted by several occurrences of loss of airspeed data on both pilot and co-pilot air speed indicators due to the accumulation of ice on the pitot probes. An investigation revealed that the accumulation of ice was due to inoperative pitot probe heaters. We are issuing this AD to prevent circuit breakers from tripping and cutting power supply to the pitot probe heater, which could cause loss of airspeed data and result in the flightcrew not being able to control the airspeed of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Replacement**

Except as provided by paragraph (h) of this AD, within 5,000 flight hours or 60 months after the effective date of this AD, whichever occurs first: Replace the existing circuit breakers in both the left and right side of the pitot heater system with circuit breakers that have higher trip points, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 8-30-39, dated November 11, 2015 (for the right side), and Bombardier Service Bulletin 8-30-40, dated November 11, 2015 (for the left side).

**(h) Airplanes That Meet the Requirements of Paragraph (g) of This AD**

For airplanes on which Bombardier ModSum IS8Q3000004 has been incorporated in production, no action is required by paragraph (g) of this AD.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the New York ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7300; fax: 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2016-04, dated February 1, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-7267.

(2) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone: 416-375-4000; fax: 416-375-4539; email: [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet: <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 13, 2016.

**Dionne Palermo,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-14971 Filed 6-27-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

**[Docket No. FAA-2016-6989; Airspace Docket No. 16-ACE-7]**

**Proposed Amendment of Class E Airspace; Tekamah, NE**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to modify Class E airspace extending upward from 700 feet above the surface at Tekamah Municipal Airport, Tekamah, NE. Controlled airspace is necessary to accommodate standard instrument approach procedures (SIAP) at Tekamah Municipal Airport for the safety and management of Instrument Flight Rules (IFR) operations at airport.

**DATES:** Comments must be received on or before August 12, 2016.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE., West Bldg. Ground Floor Rm. W12-140, Washington, DC 20590; telephone 1-800-647-5527 or 202-366-9826. You must identify FAA Docket No. FAA-2016-6989; Airspace Docket No. 16-ACE-7, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1-800-647-5527), is on the ground floor of the building at the above address.

www.regulations.gov. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1-800-647-5527), is on the ground floor of the building at the above address.

FAA Order 7400.9Z, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.9Z at NARA, call 202-741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

FAA Order 7400.9, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:**

Jeffrey Claypool, Federal Aviation Administration, Operations Support Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX 76177; telephone (817) 222-5711.

**SUPPLEMENTARY INFORMATION:****Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part, A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would amend Class E airspace at Tekamah Municipal Airport, Tekamah, NE.

**Comments Invited**

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions