

# Proposed Rules

Federal Register

Vol. 81, No. 198

Thursday, October 13, 2016

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2016-9189; Directorate Identifier 2016-NM-114-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes. This proposed AD was prompted by reports of passenger service units (PSUs) becoming detached from the supporting airplane structure in several Model 737 airplane incidents that exceeded the design emergency load requirements for the PSUs. This proposed AD would require modifying the PSUs and life vest panels by removing the existing inboard lanyard and installing two new lanyards on the outboard edge of the PSUs and life vest panels. We are proposing this AD to prevent PSUs and life vest panels from detaching from the supporting airplane structure, which could lead to passenger injuries and impede passenger and crew egress during evacuation.

**DATES:** We must receive comments on this proposed AD by November 28, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room

W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9189.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9189; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Scott Craig, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone 425-917-6592; fax 425-917-6590; email: [michael.s.craig@faa.gov](mailto:michael.s.craig@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9189; Directorate Identifier 2016-NM-114-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory,

economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

We have received reports of PSUs becoming detached from the supporting airplane structure in several Model 737 airplane incidents that exceeded the design emergency load requirements for the PSUs. These incidents resulted in injuries to passengers' faces and heads, which may have occurred when the PSUs became dislodged and encroached into the passengers' occupiable space. Additionally, many of the PSUs above aisle seats that separated from their overhead bins were found in the cabin aisle. Such an obstruction in the rows and aisles, especially at overwing emergency exits, could delay emergency evacuation for passengers and crew. Detached PSUs and life vest panels, if not corrected, could result in passenger injuries and impede passenger and crew egress during evacuation.

#### Related Service Information Under 14 CFR Part 51

We reviewed Boeing Service Bulletin 737-25-1707, dated September 24, 2015. The service information describes procedures for modifying the PSUs and life vest panels by removing the existing inboard lanyard and installing two new lanyards on the outboard edge of the PSUs and life vest panels. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

**Proposed AD Requirements**

This proposed AD would require accomplishing the actions specified in the service information described previously. For information on the

procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9189.

**Costs of Compliance**

We estimate that this proposed AD affects 1,087 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
PSU modification .....	68 work-hours × \$85 per hour = \$5,780 .....	\$16,100	\$21,880	\$23,783,560
Life vest panel modification .....	9 work-hours × \$85 per hour = \$765 .....	2,004	2,769	3,009,903

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA-2016-9189; Directorate Identifier 2016-NM-114-AD.

**(a) Comments Due Date**

We must receive comments by November 28, 2016.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to the Boeing Company Model 737-600, -700, -700C, -800, -900, and -900ER series airplanes, certificated in any category, as identified in Boeing Service Bulletin 737-25-1707, dated September 24, 2015.

**(d) Subject**

Air Transport Association (ATA) of America Code 25; Equipment/furnishings.

**(e) Unsafe Condition**

This AD was prompted by reports of passenger service units (PSUs) becoming detached from the supporting airplane structure in several Model 737 airplane incidents that exceeded the design emergency load requirements. We are issuing this AD to prevent PSUs and life vest panels from detaching from the supporting airplane structure, which could lead to passenger injuries and impede passenger and crew egress during evacuation.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Installation**

Within 60 months after the effective date of this AD: Do the applicable actions required in paragraphs (g)(1) and (g)(2) of this AD, in accordance with the Accomplishment Instructions of Boeing Service Bulletin 737-25-1707, dated September 24, 2015.

(1) For all airplanes: Remove the existing lanyard and install new lanyard assemblies in the PSUs.

(2) For Group 2 airplanes, as identified in Boeing Service Bulletin 737-25-1707, dated September 24, 2015: Remove the existing lanyard and install new lanyard assemblies in the life vest panels.

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (i)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (h)(4)(i) and (h)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures

identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

#### (i) Related Information

(1) For more information about this AD, contact Scott Craig, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle ACO, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone 425-917-6592; fax 425-917-6590; email: [michael.s.craig@faa.gov](mailto:michael.s.craig@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on September 27, 2016.

#### Dionne Palermo,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-24508 Filed 10-12-16; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 171

[Docket No. FAA-2016-9173; Airspace Docket No. 16-AAL-2]

#### Proposed Amendment of Class E Airspace, Barter Island, AK

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to modify Class E airspace at Barter Island LRRS Airport, Barter Island, AK because the North Slope Borough is relocating the airport. The FAA found modification of this airspace and adjustment of the airport's geographic coordinates necessary for the safety and management of Instrument Flight Rules (IFR) operations at the airport.

**DATES:** Comments must be received on or before November 28, 2016.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE., West Building Ground Floor, Room W12-140, Washington, DC 20590; telephone: 1-800-647-5527, or (202) 366-9826. You must identify FAA Docket No. FAA-2016-9173; Airspace Docket No. 16-AAL-2, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays.

FAA Order 7400.11A, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11A at NARA, call 202-741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:** Tom Clark, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone (425) 203-4511.

#### SUPPLEMENTARY INFORMATION:

##### Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it would

amend Class E airspace at Barter Island LRRS Airport, Barter Island, AK.

#### Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal. Communications should identify both docket numbers and be submitted in triplicate to the address listed above. Persons wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. FAA-2016-9173/Airspace Docket No. 16-AAL-2." The postcard will be date/time stamped and returned to the commenter.

All communications received before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this notice may be changed in light of the comments received. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

#### Availability of NPRMs

An electronic copy of this document may be downloaded through the Internet at <http://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's Web page at [http://www.faa.gov/air\\_traffic/publications/airspace\\_amendments/](http://www.faa.gov/air_traffic/publications/airspace_amendments/).

You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office (see the **ADDRESSES** section for the address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined during normal business hours at the Northwest Mountain Regional Office of the Federal Aviation Administration, Air Traffic Organization, Western Service Center, Operations Support Group, 1601 Lind Avenue SW., Renton, WA 98057.