

all applicable actions specified in paragraph (h)(1) or (h)(2) of this AD, in accordance with the Accomplishment Instructions of Dassault Service Bulletin F900EX-464, dated June 20, 2016. After the applicable actions specified in paragraph (h)(1) or (h)(2) of this AD have been completed, the AFM revision required by paragraph (g) of this AD may be removed from the AFM for that airplane.

(1) If during the inspection required by the introductory text to paragraph (h) of this AD it is determined that a diaphragm is present: Before further flight, replace the wing anti-ice system ducting.

(2) If during the inspection required by the introductory text to paragraph (h) of this AD it is determined that a diaphragm is not present: Before further flight, do a check of the anti-ice pipe part number and re-identify the wing anti-ice system ducting.

(i) New Actions: Inspection, Part Replacement, Part Re-identification

For Model FALCON 2000EX airplanes: Within 9 months after the effective date of this AD, do a detailed inspection of the wing anti-ice system ducting (anti-ice pipe) for the presence of a diaphragm, and do all applicable actions specified in paragraph (i)(1) or (i)(2) of this AD, in accordance with the Accomplishment Instructions of Dassault Service Bulletin F2000EX-393, dated June 20, 2016. After the applicable actions specified in paragraph (i)(1) or (i)(2) of this AD have been completed, the AFM revision required by paragraph (g) of this AD may be removed from the AFM for that airplane.

(1) If during the inspection required by the introductory text to paragraph (i) of this AD it is determined that a diaphragm is not present: Before further flight, replace the wing anti-ice system ducting.

(2) If during the inspection required by the introductory text to paragraph (i) of this AD it is determined that a diaphragm is present: Before further flight, do a check of the anti-ice pipe part number and re-identify the wing anti-ice system ducting.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section,

Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Emergency AD 2016-0130-E, dated July 5, 2016, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1023.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1149.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following service information was approved for IBR on October 27, 2017 (82 FR 44305, September 22, 2017).

(i) Dassault Aviation Service Bulletin F900EX-464, dated June 20, 2016.

(ii) Dassault Aviation Service Bulletin F2000EX-393, dated June 20, 2016.

(4) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; Internet <http://www.dassaultfalcon.com>.

(5) You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on November 7, 2017.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2017-24810 Filed 11-17-17; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2017-0773; Product Identifier 2017-NM-067-AD; Amendment 39-19101; AD 2017-23-07]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for all The Boeing Company Model 737-100, -200, -200C, -300, -400, and -500 series airplanes. This AD was prompted by reports of cracks found in the lower chord of the left wing rear spar. This AD requires repetitive inspections for cracking of the lower chord of the rear spar and lower aft skin and applicable on-condition actions. We are issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective December 26, 2017.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of December 26, 2017.

ADDRESSES: For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0773.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0773; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S.

Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT:

Payman Soltani, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5313; fax: 562-627-5210; email: payman.soltani@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all The Boeing Company Model 737-100, -200, -200C, -300, -400, and -500 series airplanes. The NPRM published in the **Federal Register** on August 15, 2017 (82 FR 38641). The NPRM was prompted by reports of cracks found in the lower chord of the left wing rear spar. The NPRM proposed to require repetitive low frequency eddy current (LFEC) inspections for cracking of the lower chord of the rear spar and detailed inspections for cracking of the lower aft skin at wing buttock line (WBL) 157 and applicable on-condition actions.

We are issuing this AD to detect and correct cracking of the lower chord of the rear spar and the lower aft skin at WBL 157.

Comments

We gave the public the opportunity to participate in developing this final rule. We have considered the comments received.

Support for the NPRM

The Boeing Company supported the NPRM.

Effect of Winglets on Accomplishment of the Proposed Actions

Aviation Partners Boeing stated that accomplishing the Supplemental Type Certificate (STC) ST01219SE does not affect the actions specified in the NPRM.

We concur with the commenter. We have redesignated paragraph (c) of the proposed AD as paragraph (c)(1) of this AD and added paragraph (c)(2) to this AD to state that installation of STC ST01219SE does not affect the ability to accomplish the actions required by this AD. Therefore, for airplanes on which STC ST01219SE is installed, a “change in product” alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

Conclusion

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this final rule with the change described previously and minor editorial changes.

We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this final rule.

Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 737-57A1333, dated May 12, 2017. This service information describes procedures for repetitive LFEC inspections for cracking of the lower chord of the rear spar and detailed inspections for cracking of the lower aft skin at WBL 157, applicable on-condition actions (e.g., repair), and instructions for airplanes that have an existing repair in the inspection area. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

We estimate that this AD affects 190 airplanes of U.S. registry. We estimate the following costs to comply with this AD:

ESTIMATED COSTS

| Action | Labor cost | Parts cost | Cost per product | Cost on U.S. operators |
|--------------------------------|---|------------|-----------------------------|---------------------------------------|
| LFEC and detailed inspections. | 10 work-hours × \$85 per hour = \$850 per inspection cycle. | \$0 | \$850 per inspection cycle. | Up to \$161,500 per inspection cycle. |

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD.

We have received no definitive data that would enable us to provide cost estimates for the instructions for airplanes that have an existing repair in the inspection area specified in this AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701:

“General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs

applicable to transport category airplanes to the Director of the System Oversight Division.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2017–23–07 The Boeing Company:
Amendment 39–19101; Docket No. FAA–2017–0773; Product Identifier 2017–NM–067–AD.

(a) Effective Date

This AD is effective December 26, 2017.

(b) Affected ADs

None.

(c) Applicability

(1) This AD applies to all The Boeing Company Model 737–100, –200, –200C, –300, –400, and –500 series airplanes, certificated in any category.

(2) Installation of Supplemental Type Certificate (STC) ST01219SE ([http://rgl.faa.gov/Regulatory_and_Guidance_Library/rstc.nsf/0/ebd1cec7b301293e86257cb30045557a/\\$FILE/ST01219SE.pdf](http://rgl.faa.gov/Regulatory_and_Guidance_Library/rstc.nsf/0/ebd1cec7b301293e86257cb30045557a/$FILE/ST01219SE.pdf)) does not affect the ability to accomplish the actions required by this AD. Therefore, for airplanes on which STC ST01219SE is installed, a “change in product” alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by the report of a crack indication in the horizontal flange of the lower chord of the left wing rear spar at wing buttock line (WBL) 157 and multiple reports of similar crack findings on other airplanes. We are issuing this AD to detect and correct cracking of the lower chord of the rear spar and the lower aft skin at WBL 157.

Undetected cracks could lead to the inability of the lower chord of the rear spar, a principal structural element, to sustain limit load, which could adversely affect the structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) For Group 2 airplanes identified in Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017: Except as required by paragraph (h) of this AD, at the applicable times specified in paragraph 1.E., “Compliance,” of Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, do all applicable actions identified as “RC” (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017.

(2) For Group 1 airplanes identified in Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017: Within 120 days after the effective date of this AD, inspect the airplane and do all applicable corrective actions using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, uses the phrase “after the original issue date of this service bulletin,” for purposes of determining compliance with the requirements of this AD, the phrase “after the effective date of this AD” must be used.

(2) Where Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017, specifies contacting Boeing, and specifies that action as RC: This AD requires using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, to make those findings. To be approved, the repair method, modification

deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h)(2) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

(j) Related Information

For more information about this AD, contact Payman Soltani, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5313; fax: 562–627–5210; email: payman.soltani@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 737–57A1333, dated May 12, 2017.

(ii) Reserved.

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; Internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on November 6, 2017.

Dionne Palermo,

Acting Director, System Oversight Division, Aircraft Certification Service.

[FR Doc. 2017–24732 Filed 11–17–17; 8:45 am]

BILLING CODE 4910–13–P