

of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) Except as required by paragraph (h) of this AD: For service information that contains steps that are labeled as RC, the provisions of paragraphs (i)(4)(i) and (i)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

#### (j) Related Information

For more information about this AD, contact Lu Lu, Aerospace Engineer, Airframe Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3525; email: [lu.lu@faa.gov](mailto:lu.lu@faa.gov).

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Aviation Partners Boeing Service Bulletin AP737C-57-002, dated April 5, 2017.

(ii) Reserved.

(3) For service information identified in this AD, contact Aviation Partners Boeing, 2811 South 102nd St., Suite 200, Seattle, WA 98168; phone: 1-206-830-7699; fax: 1-206-767-3355; email: [leng@aviationpartners.com](mailto:leng@aviationpartners.com); internet: <http://www.aviationpartnersboeing.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on March 5, 2018.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-05016 Filed 3-16-18; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2018-0210; Product Identifier 2018-CE-004-AD; Amendment 39-19229; AD 2018-06-09]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Pacific Aerospace Limited Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for Pacific Aerospace Limited Model 750XL airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by the aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as the possibility for the control column to snag on the cockpit control tee handles on certain airplanes. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective April 9, 2018.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of April 9, 2018.

We must receive comments on this AD by May 3, 2018.

**ADDRESSES:** You may send comments by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** (202) 493-2251.
- **Mail:** U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may view this referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the internet at <http://www.regulations.gov> by searching for locating Docket No. FAA-2018-0210.

#### **Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0210; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### **FOR FURTHER INFORMATION CONTACT:**

Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov).

#### **SUPPLEMENTARY INFORMATION:**

##### **Discussion**

The Civil Aviation Authority, which is the aviation authority for New Zealand, has issued CAA AD DCA/750XL/22, dated December 19, 2017 (referred to after this as "the MCAI"), to correct an unsafe condition for Pacific Aerospace Limited Model 750XL airplanes. To accompany that MCAI, the CAA issued Notification of Airworthiness Directive issued for New Zealand Aeronautical Products IAW ICAO Annex 8, dated December 21, 2017; the Notification states:

This [CAA] AD is prompted by a ground inspection which found it is possible for the control column to snag on the cockpit control tee handles on certain aircraft. When the tee handle is pulled out to the maximum limit it fouls with the control column in the extreme forward right and left positions. The tee handles are mounted below the switch panels adjacent to the centre console.

This [CAA] AD with effective date 28 December 2017 mandates the inspection and corrective actions per the Accomplishment

Instructions in Pacific Aerospace Mandatory Service Bulletin (MSB) PACSB/XL/093 issue 1, dated 15 December 2017, or later approved revision.

You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0210.

#### Related Service Information Under 1 CFR Part 51

Pacific Aerospace Limited has issued Pacific Aerospace Mandatory Service Bulletin PACSB/XL/093, Issue 1, dated December 15, 2017. The service information describes procedures for inspecting the ventilation, heater, and air filter bypass control tee handles for snagging of the control column, and adjustment of the control tee handle if necessary. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of the AD.

#### FAA's Determination and Requirements of the AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are issuing this AD because we evaluated all information provided by the State of Design Authority and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### FAA's Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because interference with the control column operations can result in the flight controls becoming jammed, which could result in uncontrollable flight. Therefore, we find good cause that notice and opportunity for prior public comment are impracticable. In addition, for the reason(s) stated above, we find that good cause exists for making this amendment effective in less than 30 days.

#### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We

invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the ADDRESSES section. Include "Docket No. FAA-2018-0210; Directorate Identifier 2018-CE-004-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

#### Costs of Compliance

We estimate that this AD will affect 22 products of U.S. registry. We also estimate that it would take about 2 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the AD on U.S. operators to be \$3,740, or \$170 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2018-06-09 Pacific Aerospace Limited:**  
Amendment 39-19229; Docket No. FAA-2018-0210; Directorate Identifier 2018-CE-004-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective April 9, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Pacific Aerospace Limited Models 750XL airplanes, all serial numbers up to and including serial number XL215, certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 27: Flight Controls.

#### (e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) issued by the aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as the possibility for the control column to snag on the cockpit control tee handles on certain aircraft. We are issuing this AD to prevent the control tee handles from snagging the control column and becoming jammed, which could result in uncontrollable flight.

**(f) Actions and Compliance**

Unless already done, do the actions in paragraph (f)(1) and (2) of this AD following the Accomplishment Instructions in Pacific Aerospace Mandatory Service Bulletin PACSB/XL/093, Issue 1, dated December 15, 2017.

(1) Within 30 days after April 9, 2018 (the effective date of this AD), inspect the ventilation, heater, and air filter bypass control tee handles (as applicable) for snagging of the control column.

(2) If the control column snags the adjacent heater, ventilation, or an engine air filter bypass control tee handle during the inspection required in paragraph (f)(1) of this AD, before further flight, reorient the affected tee handle.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, Standards Office, FAA; or the Civil Aviation Authority of New Zealand (CAA).

**(h) Related Information**

Refer to the MCAI by the CAA, AD DCA/750XL/23, dated December 28, 2017; and Pacific Aerospace Mandatory Service Bulletin PACSB/XL/093, Issue 1, dated December 15, 2017, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0210.

**(i) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Pacific Aerospace Mandatory Service Bulletin PACSB/XL/093, Issue 1, dated December 15, 2017.

(ii) Reserved.

(3) For service information identified in this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz).

(4) You may view this service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the internet at <http://www.regulations.gov> by searching for locating Docket No. FAA-2018-0210.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on March 9, 2018.

Pat Mullen,

Acting Deputy Director, Policy & Innovation Division, Aircraft Certification Service.

[FR Doc. 2018-05355 Filed 3-16-18; 8:45 am]

BILLING CODE 4910-13-P

**SUSQUEHANNA RIVER BASIN COMMISSION****18 CFR Part 801****General Policies**

**AGENCY:** Susquehanna River Basin Commission.

**ACTION:** Final rule.

**SUMMARY:** This document contains rules that amend the regulations of the Susquehanna River Basin Commission (Commission) to codify the Commission's Access to Records Policy providing rules and procedures for the public to request and receive the Commission's public records.

**DATES:** The rule is effective March 19, 2018.

**ADDRESSES:** Susquehanna River Basin Commission, 4423 N Front Street, Harrisburg, PA 17110-1788.

**FOR FURTHER INFORMATION CONTACT:** Jason E. Oyler, Esq., General Counsel, 717-238-0423, ext. 1312; [joyler@srbc.net](mailto:joyler@srbc.net). Also, for further information on the final rule, visit the Commission's website at <http://www.srbc.net>.

**SUPPLEMENTARY INFORMATION:** Notice of proposed rulemaking was published in the *Federal Register* on October 12, 2017 (82 FR 47407); *New York Register* on October 25, 2017; *Pennsylvania Bulletin* on October 21, 2017; and *Maryland Register* on October 27, 2017. The Commission convened a public hearing on November 2, 2017, in Harrisburg, Pennsylvania. A written comment period was held open through November 13, 2017.

The Commission received one comment on the proposed rule, which

was supportive of the Commission's efforts to formalize its Access to Records Policy. The Commission also received two comments after the close of the official public comment period suggesting some changes to rulemaking.

Based upon input from the Commission's member jurisdictions, subsection (b)(4) is amended and a new subsection (f) is added to create an exception to records subject to public access for those internal, pre-decisional deliberations between staff and member jurisdictions working in cooperation with the Commission. The Commission will also modify § 801.14(b)(1) to clarify that it does not prohibit the Commission from providing salary information in response to records requests, as the Commission has historically released these records upon request. Section 801.14(b)(8) is also modified to exclude the provision of financial documents related to critical infrastructure.

Based on public input the Commission clarifies the following:

- The Commission does intend to review and revisit its Access to Records Policy after adoption of the final rule to update its procedures.

- The final rule, § 801.14(c)(3), provides that the Commission must respond in a reasonable time frame. The Commission works with requesters and generally responds to records requests within 30 days of the request. The reasonable timeframe language allows the Commission to deal with requests varying in complexity and magnitude while continuing to balance prompt access to records with the agency's other obligations and limitations.

Through this final rule, the Commission continues its long tradition of transparency by formalizing the key elements of its Access to Records Policy in duly promulgated regulations. The Commission's 2009 Access to Records Policy, which remains in effect, can be found at: [http://www.srbc.net/pubinfo/docs/2009-02\\_Access\\_to\\_Records\\_Policy\\_20140115.pdf](http://www.srbc.net/pubinfo/docs/2009-02_Access_to_Records_Policy_20140115.pdf). The Commission's current records processing fee schedule can be found at: [http://www.srbc.net/pubinfo/docs/RecordsProcessing\\_FeeScheduleUpdatedAddress.pdf](http://www.srbc.net/pubinfo/docs/RecordsProcessing_FeeScheduleUpdatedAddress.pdf).

**List of Subjects in 18 CFR Part 801**

Administrative practice and procedure, Water resources.

Accordingly, for the reasons set forth in the preamble, the Susquehanna River Basin Commission amends 18 CFR part 801 as follows:

**PART 801—GENERAL POLICIES**

■ 1. The authority citation for part 801 is revised to read as follows: